 



# MOUNTING INSTRUCTIONS FOR CX3 SPRINGCONNECT CONNECTORS

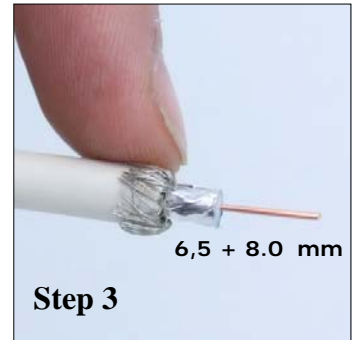

**STEP 1:** Insert the cable as shown. Turn the tool clockwise 5-7 times.

**STEP 2:** Take a good grip on the tool and pull out the cable.

**STEP 3:** Fold the exposed braid back over the jacket the as shown. Stripping dimensions should be 6.5 + 8.0 mm\*.

**STEP 4:** If the inner conductor is too long, then cut it down to be 8 mm\* long.

**STEP 5:** Push the connector over the cable until the dielectric is flush with the post interface (pic. 5 b).

**STEP 6:** Make sure the install the proper plunger tip (marked "A") in the tool (the same as for short connectors). Insert the cable as shown and close the tool handles completely together. Release and take out the compressed connector.

\* Stripping dimensions is normally 6.5 + 6.5 mm for Cabelcon drop connectors. This will also work for the SpringConnect™. The reason why we recommend 8 mm inner conductor length for the SpringConnect™ is to ensure longer lasting continuity when the connector is pulled out.

Ver. 100311

Distributor:

**CABELCON**  
connectors

Corning Cabelcon ApS, Industriparken 10, DK 4760 Vordingborg  
Tel: +45 55 98 55 99 · Fax: +45 55 98 55 04  
E-mail: cabelcon@cabelcon.dk · www.cabelcon.dk